



SCHWEIZER SERVICE NOTICE

* Supercedes Service Information Letter No. L-122, Dated 1 Sept. 1981 and No. L-135, Dated 26 June 1984

MANDATORY

MANDATORY

MANDATORY

SUBJECT: REDUCED SERVICE LIVES FOR 269A6065 AND 369A1706 TAIL ROTOR RETENTION STRAP ASSEMBLIES.

MODELS AFFECTED: All 269 Series Helicopters.

REFERENCE: 269 Series - HMI Appendix B, Reissued 15 August 1982

The limited service life for all P/N 269A6065 and 369A1706 (BSC) tail rotor retention strap assemblies installed on Model 269C Helicopters has been reduced to 3540 hours. All such parts in service or in spares inventory, which have exceeded 3540 hours total time in service, must be removed and scrapped.

The following table provides a complete listing of retention strap assemblies and their service life on each Model 269 Helicopter. This table should be referenced in conjunction with Table B-5 of HMI Appendix B and Table 1 of HMI Service Revision R-7 to determine the mandatory replacement schedule of limited life components.

RETENTION STRAP REPLACEMENT SCHEDULES

Part No.	269 (TH-55A)	269A, 269A-1, 269B	269C
269A6065	1531	2800	3540 (NOTE 1)
369A1706	1531	2800	3540 (NOTE 1)
369A1706-505 (NOTE 2)	1531	2800	5100
369A1706-507	1531	2800	5100

NOTES:

1. Service life reduced from 5100 hours.
2. -505 assemblies identified by a blue dot on inboard shoe of basic part number (369A1706) strap pack assembly.

It should be noted that all rules and notes that apply to Table B-5 of HMI Appendix B, also apply to the table provided in this Service Information Notice.

The information provided by this Service Information Notice is to be considered as part of the HMI and will be incorporated at the next scheduled revision of 269 Series HMI Appendix B.

REFERENCE SHEET

SERVICE INFORMATION NOTICE AND LETTERS

ACTION REFERENCE: Refer to Service Information Notice N-214 to determine the finite service life of tail rotor retention strap assemblies.

HMI REFERENCE: Insert this sheet in 269 Series HMI Appendix B, preceding Page 2-27.

This Reference Sheet shall be kept as part of the manual until the data can be incorporated at the next revision of 269 Series HMI Appendix B. (See Service Information Summary, page i of HMI Appendix B.)