

269C-1™ HELICOPTER

ALERT SERVICE

BULLETIN



NOTICE TO ALL PERSONS RECEIVING THIS DOCUMENT:

WARNING: THIS DOCUMENT, OR AN EMBODIMENT OF IT IN ANY MEDIA, DISCLOSES INFORMATION WHICH IS PROPRIETARY, IS THE PROPERTY OF SIKORSKY AIRCRAFT CORPORATION AND/OR ITS SUBSIDIARIES, IS AN UNPUBLISHED WORK PROTECTED UNDER APPLICABLE COPYRIGHT LAWS, AND IS DELIVERED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED, DISCLOSED, REPRODUCED, IN WHOLE OR IN PART (INCLUDING REPRODUCTION AS A DERIVATIVE WORK), OR USED FOR MANUFACTURE FOR ANYONE OTHER THAN SIKORSKY AIRCRAFT CORPORATION AND/OR ITS SUBSIDIARIES WITHOUT ITS WRITTEN CONSENT, AND THAT NO RIGHT IS GRANTED TO DISCLOSE OR SO USE ANY INFORMATION CONTAINED HEREIN. ALL RIGHTS RESERVED. ANY ACT IN VIOLATION OF APPLICABLE LAW MAY RESULT IN CIVIL AND CRIMINAL PENALTIES.

EXPORT WARNING: THESE COMMODITIES, TECHNICAL DATA OR SOFTWARE ARE SUBJECT TO THE EXPORT CONTROL OF EITHER THE INTERNATIONAL TRAFFIC IN ARMS REGULATIONS (ITAR) OR THE EXPORT ADMINISTRATION REGULATIONS (EAR) AND CANNOT BE EXPORTED WITHOUT THE PRIOR AUTHORIZATION OF EITHER THE DEPARTMENT OF STATE OR THE DEPARTMENT OF COMMERCE. THE TERM "EXPORT" INCLUDES ANY DISCLOSURE AND/OR PROVISION OF ACCESS TO COMMODITIES, TECHNICAL DATA OR SOFTWARE TO OR BY FOREIGN NATIONALS (WHETHER LOCATED IN THE UNITED STATES OR ABROAD). THIS REQUIREMENT ALSO APPLIES TO FOREIGN NATIONAL EMPLOYEES OF U.S. COMPANIES AND THEIR FOREIGN SUBSIDIARIES.

269C-1™ IS A REGISTERED TRADEMARK OF SIKORSKY AIRCRAFT CORPORATION.

ASB C1B-042

Basic Issue ▪ November 21/14

SUBJECT: One-Time Inspection of Tail Rotor Flight Control Cables, Pulleys, and Forward and Aft Bellcranks for Damage and/or Wear, and Verification of Parts Configuration

Section 1. PLANNING INFORMATION

- A. **Effectivity** All 269C-1 model helicopters.
- B. **Purpose** To perform a one-time inspection of tail rotor flight control cables, pulleys, and forward and aft bellcranks for damage and/or wear, and verification of parts configuration.
- C. **Description** Helicopter is prepared for inspection. Access is gained to the tail rotor flight control cables, pulleys, and forward and aft bellcranks. Tail rotor flight control cables, pulleys, and forward and aft bellcranks are inspected. Routing and alignment of cables are inspected. Tail rotor control cables, forward and aft bellcranks, pulleys, and hardware are removed. Tail rotor flight control cables, pulleys, and forward and aft bellcranks are re-inspected. Cleanliness and corrosion inspection is completed. If necessary, any worn and/or damaged parts are replaced. Tail rotor control cables are reinstalled. Cable routing inspection and rigging checks are completed. Results are recorded on Tail Rotor Flight Control Cables, Pulleys, and Forward and Aft Bellcranks Inspection Data Sheet (attached). Helicopter is returned to service.
- D. **Compliance** Compliance is essential. The inspection outlined herein shall be accomplished no later than the next 100 hour inspection or 90 days from the issue date of this Alert Service Bulletin (ASB), whichever occurs first.
- E. **Approval** Inspection Item.

ONE-TIME
INSPECTION

Section 1. PLANNING INFORMATION (Continued)

F. Manpower (Estimated)

Task	No. of Men	No. of Hours	Man-Hours*
Prepare aircraft for inspection.	1	0.25	0.25
Inspect tail rotor cables, cable tension, cable bellcranks, and associate hardware.**	2	0.60	0.80
Remove tail rotor cables.	1	0.50	0.50
Inspect removed tail rotor cables.	1	0.25	0.25
Reinstall tail rotor cables.**	2	0.70	0.90
Conduct rigging check of tail rotor controls.**	2	0.80	1.00
Reinstall/close access panels.	1	0.40	<u>0.40</u>
Total Man-Hours			4.10

*Estimate does not include time required to prepare helicopter or return it to flight status.

**Estimate does not require two people for entire task.

G. Tooling

None.

H. Weight and Balance

Not affected.

I. Electrical Load Data

Not affected.

J. Software Load Data

Not applicable.

K. References

- (1) Handbook of Maintenance Instructions (HMI) CSP-C1-2.
- (2) HMI, Appendix D, Corrosion Control Manual.
- (3) HMI, Section 13.

Section 1. PLANNING INFORMATION (Continued)

L. Publications Affected

- (1) Temporary Revision No. 269C1-26 against HMI CSP-C1-2, Section 9, Figure 9-1 will be issued at a later date.
- (2) Temporary Revision No. 269C1-27 against HMI CSP-C1-2, Section 9, Paragraph 9-33 will be issued at a later date.
- (3) Temporary Revision No. 269C1-28 against HMI CSP-C1-2, Appendix B, Section 2, Table B-2 will be issued at a later date.
- (4) Temporary Revision No. 269C1-29 against HMI CSP-C1-2, Appendix B, Section 2, Table B-2 will be issued at a later date.

M. Attachment

None.

Section 2. MATERIAL INFORMATION

A. Basis for Material Data

Per helicopter.

B. Bill of Material

None.

C. Consumable Material

None.

Section 3. ACCOMPLISHMENT INSTRUCTIONS

A. Prepare helicopter for inspection:

- (1) Turn off all helicopter electrical power.
- (2) Gain access to tail rotor flight control cables, pulleys, and forward and aft bellcranks.

B. Perform tail rotor flight controls inspection as follows:

NOTE: Make sure to record inspection results on Tail Rotor Flight Control Cables, Pulleys, and Forward and Aft Bellcranks Inspection Data Sheet. (Refer to Step D, and Tables 1, 2, and 3).

- (1) Inspect tail rotor flight control cables, pulleys, and forward and aft bellcranks, and measure initial cable tension. (Refer to HMI CSP-C1-2, Paragraph 9-35). Record initial cable tension results on Tail Rotor Flight Control Cables, Pulleys, and Forward and Aft Bellcranks Inspection Data Sheet.

ONE-TIME
INSPECTION

Section 3. ACCOMPLISHMENT INSTRUCTIONS (Continued)

- (2) Inspect routing and alignment of cables around bellcranks, pulleys, and through routing holes on airframe. No rubbing or chafing is allowed. (Refer to HMI CSP-C1-2, Paragraph 9-35).

NOTE: Perform only steps necessary to remove tail rotor control cables.

- (3) Remove tail rotor control cables. (Refer to HMI CSP-C1-2, Paragraph 9-32).
- (4) With cables removed, inspect tail rotor control cables, forward and aft bellcranks, pulleys, and hardware. (Refer to HMI CSP-C1-2, Paragraph 9-33).

NOTE: Make sure forward bellcrank is secure, and not rubbing against the forward spacer and/or aft stop.

- (5) Apply slight force to bellcrank, and make sure forward bellcrank mounting bolt is not loose or elongated. If repair is required, refer to HMI, section 13.
- (6) Inspect tail rotor control cable pulleys and aft bellcrank for worn cable grooves and worn bearings. (Refer to HMI CSP-C1-2, Paragraph 9-33).
- (7) Inspect all tail rotor control cable components, bellcranks, mounts, and hardware for cleanliness and corrosion. If corrosion is found or corrosion protection is required, refer to HMI Appendix D, Corrosion Control Manual.

- (8) Replace any worn and/or damaged cables, and/or any unserviceable parts. (Refer to HMI CSP-C2, Paragraph 9-33).

- (9) Reinstall tail rotor control cables. (Refer to HMI CSP-C1-2, Paragraph 9-35).

NOTE: Make sure cable is routed around forward bellcrank in the intended guiding slots, and not over forward spacer.

NOTE: Make sure cable is not chafing anywhere, including against forward spacer, aft stop, and/or any other part of airframe.

- (10) Inspect routing of tail rotor control cables. (Refer to HMI CSP-C1-2, Paragraph 9-33).
- (11) Perform rig check of tail rotor controls. (Refer to HMI CSP-C1-2, Paragraph 9-3).
- (12) Record inspection results on Tail Rotor Flight Control Cables, Pulleys, and Forward and Aft Bellcranks Inspection Data Sheet. (Refer to Step D, and Tables 1, 2, and 3).

C. Return helicopter to service.

Section 3. ACCOMPLISHMENT INSTRUCTIONS (Continued)

D. Tail Rotor Flight Control Cables, Pulleys, and Forward and Aft Bellcranks Inspection Data Sheet

(1) Report the following data to Sikorsky Aircraft Corporation.

Date ASB is Performed: _____

Customer/Operator Name: _____

Helicopter Serial Number: _____

Helicopter Total Time Since New: _____

Initial Tail Rotor Control Cable Tension: _____

Tail Rotor Control Cables correctly installed
per HMI:

Yes _____ No _____

Wear and/or damage found on the tail rotor
cables:

Yes _____ No _____

If Yes, complete Table 1.

Damage to cables or airframe due to
misrouting:

Yes _____ No _____

If Yes, complete Table 2.

Any additional discrepancies, improper
assembly, pulley damage, bellcrank damage,
etc:

Yes _____ No _____

If Yes, complete Table 3.

ONE-TIME
INSPECTION

Section 3. ACCOMPLISHMENT INSTRUCTIONS (Continued)

TABLE 1					
Damage Type (Chafing, wear, or other damage)	Location (distance from feature)	Size of Damage (inches)	Part Number	Part Serial Number (if applicable)	Total Time on Discrepant Part (if applicable)

TABLE 2					
Damage Type (Chafing, wear, or other damage)	Location (distance from feature)	Size of Damage (inches)	Part Number	Part Serial Number (if applicable)	Total Time on Discrepant Part (if applicable)

TABLE 3					
Type and/or Condition	Location (distance from feature)	Size of Damage (inches)	Part Number	Part Serial Number (if applicable)	Total Time on Discrepant Part (if applicable)

Section 3. ACCOMPLISHMENT INSTRUCTIONS (Continued)

E. Record of compliance:

- (1) Make an appropriate helicopter logbook entry to show compliance with this ASB.
- (2) Upon compliance with the ASB, complete attached ALERT SERVICE BULLETIN COMPLIANCE RECORD CARD and ASB Work Sheet and return it to Sikorsky Aircraft Corporation

ONE-TIME
INSPECTION

(Fold over and tape closed)

SIKORSKY AIRCRAFT CORPORATION

FACSIMILE NUMBER (860) 998-7565

EMAIL ADDRESS: GPSIKSASProductSafet@utc.com

ATTENTION: SAS PRODUCT SAFETY MANAGER
SIKORSKY AEROSPACE SERVICES



IMPORTANT NOTICE

Upon **COMPLIANCE** with the attached ASB, Sikorsky requests your cooperation in completing and returning this **ENTIRE PAGE** by **MAIL, FAX, or scan & EMAIL**.

If you have internet access, you may go to www.sikorsky.com to record your compliance.

Please fill in the requested information at the bottom of the page, so we may maintain proper records documenting the configuration of your aircraft. This information is useful when determining configuration and effectivity of issues affecting fielded aircraft.

This request is in keeping with our policy to assure that our customers receive the latest information applicable for the maintenance of your aircraft. Thank you.

ALERT SERVICE BULLETIN: ASB No. C1B-042 **Compliance Record Card**

TITLE: One-Time Inspection of Tail Rotor Flight Control Cables, Pulleys, and Forward
and Aft Bellcranks for Damage and/or Wear, and Verification of Parts
Configuration

OWNER/OPERATOR: _____

SUBMITTED BY: _____ **DATE:** _____

FOLLOWING SERIAL NUMBERS ARE NOT AFFECTED BY THIS ASB

ASB HAS BEEN COMPLIED WITH ON HELICOPTER SERIAL NUMBERS:

(Fold Up to Arrows)



No Postage
Necessary

BUSINESS REPLY MAIL
FIRST-CLASS MAIL PERMIT NO. 432 BRIDGEPORT CT

POSTAGE WILL BE PAID BY ADDRESSEE

SIKORSKY AIRCRAFT CORPORATION
P.O. BOX 9729
6900 MAIN STREET
STRATFORD, CONNECTICUT 06615-9129 U.S.A.
MAILSTOP: **S328A**
ATTENTION: SAS PRODUCT SAFETY MANAGER
SIKORSKY AEROSPACE SERVICES

Please complete the form on the reverse side and FAX to
FACSIMILE NUMBER (860) 998-7565
Or scan and email to:
EMAIL ADDRESS: GPSIKSASProductSafet@utc.com
or fold and return ENTIRE form to Sikorsky Aircraft Corporation