



# SCHWEIZER SERVICE BULLETIN

DB-017  
13 Nov 2006

MANDATORY

MANDATORY

MANDATORY

**SUBJECT:** INSTALLATION OF LATCH ASSY FUEL CELL COVER KIT

**MODELS AFFECTED:** All 269D Model helicopters serial numbers 0001 through 0059A.

**TIME OF COMPLIANCE:** At next 100 hours inspection or 3 months from the date of this Service Bulletin, whichever occurs first.

**REFERENCE:** SA-269DK-032 Kit Instructions

- PREFACE:**
- Schweizer Aircraft Corp. has received reports of fuel cell caps not being properly installed after fuel servicing which has led to loss of fuel out of the fuel cell during flight. The SA-269DK-032 Latch Assembly Fuel Cell Cover Kit provides parts and instructions to modify the fuel cell cap in order to incorporate a fuel cell cap spring loaded to the closed position. This provides for positive closing of the cap after fuel servicing of the helicopter. 269D helicopter serial numbers 0060A and subsequent will be delivered with this feature incorporated.
  - Failure to comply with this Service Bulletin may lead to serious injury, death, and/or property damage as a result of fire due to fuel spillage.

**APPROVAL:** Engineering aspects of this Service Bulletin are FAA approved.

**PARTS REQUIRED:** SA-269DK-032 Latch Assembly Fuel Cell Cover Kit.

**PROCEDURE:**

- a. Install 269D4253-003 hinge spring assy. in accordance with SA-269DK-032 kit installation instructions.
- b. Record compliance with this Service Bulletin in the aircraft records.

## WEIGHT AND BALANCE

Weight and Balance are not affected.