



# SCHWEIZER SERVICE BULLETIN

C1B-013.1\*  
14 Nov 2001

MANDATORY

MANDATORY

MANDATORY

SUBJECT: MAIN ROTOR SWASHPLATE BEARINGS P/N 269A1301

- MODELS AFFECTED:
- Model 269C-1 Helicopters S/N 0095 through 0130
  - Any Model 269C-1 helicopter with installed 269A1301 Swashplate Bearing sold by Schweizer Aircraft as a spare between 01 May 1999 and 05 Oct 2001
  - Any 269A1301 Swashplate Bearings or assemblies sold by Schweizer Aircraft as a spare between 01 May 1999 and 05 Oct 2001

- TIME OF COMPLIANCE:
- Installed bearings: Within the next 100 hours flight time or within 60 days from issue date of this Service Bulletin, whichever occurs first.
  - Affected spares in stock: Prior to installation or within 30 days from issue date of this Service Bulletin, whichever occurs first.

REFERENCE: Model 269C-1 Basic HMI (Issued: 14 Jul 1995; Revised: 26 Oct 2001)

- PREFACE:
- Field reports indicate that the originally supplied grease in affected swashplate bearings may be contaminated with a foreign substance that reduces the grease viscosity, and subsequently increases the possibility of bearing failure. Unless previously accomplished, it is necessary to clean, inspect, and re-lubricate the swashplate bearing at this one-time special interval. After completion of this Service Bulletin, bearing lubrication is then performed at specified intervals found in HMI Appendix B.
  - Failure to comply with this Service Bulletin may lead to loss of control of the helicopter and subsequent injury, death and/or property damage.

## PROCEDURE:

### PART I:

- a. Check aircraft records to determine if affected bearing has been serviced (cleaned and re-lubricated in the field) in accordance with HMI Section 8 after 01 May 1999.

NOTE: If bearing has not been serviced, perform PART II.

- (1) If bearing has been serviced, the conditions of this Service Bulletin are satisfied and no further action is required. Record compliance with PART I of this Service Bulletin in the aircraft records.

### PART II:

- a. Remove and disassemble main rotor swashplate assembly as necessary to gain access to swashplate bearing (Basic HMI, Section 8).
- b. Clean, inspect, and re-lubricate the swashplate bearing (Basic HMI, Section 8).

( ) Denotes portion of text added or revised

\*Supersedes C1B-013 dated 26 Oct 2001

1 of 2

**C1B-013.1\***  
**14 Nov 2001**

- c. Reassemble and install swashplate assembly (Basic HMI, Section 8).
- d. Record compliance with PART II of this Service Bulletin in the aircraft records.

**WEIGHT AND BALANCE**

Weight and balance are not affected.