



**SCHWEIZER
SERVICE INFORMATION
LETTER**

LETTER NO. L-123
DATE 1 September 1981
PAGE 1 OF 1

TO—All owners and operators of Hughes Helicopters

SUBJECT: NEW PROTECTIVE BOOT FOR 269A6034 SERIES LTS TAIL
ROTOR ASSEMBLY

MODELS AFFECTED: All Model 269 Series Helicopters equipped with subject
LTS tail rotor assembly

Reference

Model 269 Series Basic HMI, Reissued 1 April 1980

A new PN 369D21811 protective boot designed for extra stiffness and longer wear is now available as replacement for the existing nonrotating flexible boot on the tail rotor assembly. Made of neoprene impregnated nylon fabric for greater rigidity and toughness, the new boot must be lockwired in place when installed on the tail rotor assembly.

The new boot is to be secured at each end with a double wrap of MS20995C32 safetywire, drawn snug and twisted together per standard safetywire techniques.

When ordering, specify the new 369D21811 boot as replacement for the existing 369A1811, 369H1804 or 369H1804-3; or 269A6103 nonrotating inboard boot.

Edward Koch, Manager
Customer Service Department
Hughes Helicopters, Inc.

Customer Service Department

SCHWEIZER AIRCRAFT CORP. P.O. Box 147 Elmira, NY 14902