



**HUGHES
SERVICE INFORMATION
LETTER**

LETTER NO. L-57
DATE Nov. 4, 1970
PAGE 1 OF 1

TO—All owners and operators of Hughes Helicopters

SUBJECT: **NEW ATTACHING HARDWARE - ENGINE
COOLING SHROUD SIDE PANELS**

MODELS AFFECTED: 269C Helicopters Serial Nos. 0001 thru 0030

Reference

269 Series - Basic Handbook of Maintenance Instructions, Issued 1 September 1970

New type hardware is being used for attaching the two side panels to the engine cooling shroud on production line Model 269C helicopters. It is recommended that existing hardware on early Models 269C helicopters be replaced to ensure positive attachment of the side panels.

To accomplish replacement, remove the four existing screws and washers in line below the spark plug access panel on each shroud side panel. Install new MS20074-03-04 bolts and HS306-126 washers, using Loctite #40 Retaining Compound, and safetywire the bolts.

Edward Koch, Manager
Customer Service Department
Hughes Tool Company