

IUGHES

ΝΟΤ

NOTICE NO. N-12



SUBJECT:

FIELD MODIFICATION - BELT DRIVE IDLER PULLEY CLUTCH SHAFT PLUG P/N 5456

/ICE INFORMATION

MODELS AFFECTED:

269A Serial No's. 0011 through 0314; TH55A Serial No's. 0315 through 0667, 269A-1 Serial No's 0001 through 0041 and 269B Serial No's. 0001 through 0273 Helicopters.

TIME OF COMPLIANCE:

Mandatory within the next 50 hours of flight time.

PREFACE:

To prevent distortion and possible cracking of the idler pulley arms at the pivot point.

Distortion of the shaft pivot hole has occurred whenever the bolts securing the arms to the pivot shaft have been overtorqued. Service Information Notice N-8 dated July 15, 1966, defines a mandatory inspection of the arms and specifies the correct torque, 20 to 30 in. lbs. To prevent distortion and cracking due to in-advertent over-torquing, the plugs noted above are to be installed.

Reference

269A/A-1 Handbook of Maintenance Instructions 269B Handbook of Maintenance Instructions TH55A HMI Addendum Service Information Notice N-8 dtd. July 15, 1966

CUSTOMER SERVICE DEPARTMENT • HUGHES TOOL COMPANY • AIRCRAFT DIVISION • CULVER CITY, CALIFORNIA

NOTICE NO. N-12 DATE September 1, 1966 PAGE 2 OF 2

a. Remove belt drive transmission upper and lower covers.

b. Engage belt drive transmission.

c. Remove nut, washers and bolt securing one end only of pivot shaft and idler pulley arm.

d. Insert plug in end of shaft; align hole in plug with holes in shaft and arm.

e. Install bolt, two washers and nut securing arm to shaft; torque 20 to 30 in. lbs.

f. Repeat steps c. through e. for opposite end of shaft.

g. Perform an operational check of bolt engagement mechanism; repeat cycle several times.

h. While performing step g. check for audible evidence of binding.

i. Visually inspect installation.

j. Reinstall belt drive covers.

Weight & Balance Data

No applicable change caused by plug installation.

Parts Required

- 1 · · · · · · · · · · · · · · · · · ·		j. •	i i de la composición	
<u>P/N</u>	• •	Quantity		Mfg.
*5456		2		HTC-AD

*Parts may be obtained from HTC-AD Parts Department at a nominal charge.