



**HUGHES
SERVICE INFORMATION
NOTICE**

NOTICE NO. N-7

DATE July 18, 1966

PAGE 1 OF 1

FAA Approved

SUBJECT: MODIFICATION - ENGINE FUEL PUMP DRAIN LINE

**MODELS AFFECTED: 269A (TH55A) Helicopter Serial No's. 0315 through
0575, 269A-1 Helicopter Serial No's. 0001 through
0042, 269B Helicopter Serial No's. 0001 through 0273.**

TIME OF COMPLIANCE: At owners and operators discretion.

**PURPOSE: To eliminate excessive vibration and possible cracking.
Vibration of the drain line has been noted when operating
the engine at certain rpm's. The modification as noted
below reduces the possibility of vibration.**

Reference

**269A/A-1 Handbook of Maintenance Instructions (TH55A)
(Supplement added)**

269B Handbook of Maintenance Instructions

- a. Check drain line for cracks and security. Replace line if cracks are noted.**

NOTE

Proceed with steps b. and subsequent if line is intact.

- b. Using scale, measure up 4.5 inches from bottom of drain line and index point.
c. Using tube cutter, remove 4.5 inches length from drain line.
d. Deburr cut edge.
e. Touch up edge with iridite.**

CUSTOMER SERVICE DEPARTMENT • HUGHES TOOL COMPANY • AIRCRAFT DIVISION • CULVER CITY, CALIFORNIA