


# 269D™ HELICOPTER

## ALERT SERVICE

## BULLETIN

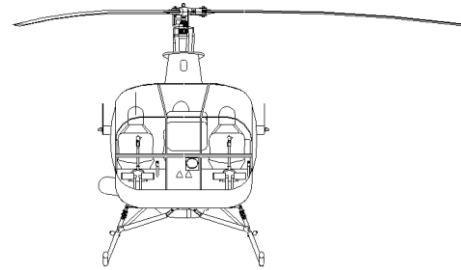

### NON-FAA CERTIFIED HELICOPTER

NOTICE TO ALL PERSONS RECEIVING THIS DOCUMENT:

WARNING: THIS DOCUMENT, OR AN EMBODIMENT OF IT IN ANY MEDIA, DISCLOSES INFORMATION WHICH IS PROPRIETARY, IS THE PROPERTY OF SIKORSKY AIRCRAFT CORPORATION AND/OR ITS SUBSIDIARIES, IS AN UNPUBLISHED WORK PROTECTED UNDER APPLICABLE COPYRIGHT LAWS, AND IS DELIVERED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED, DISCLOSED, REPRODUCED, IN WHOLE OR IN PART (INCLUDING REPRODUCTION AS A DERIVATIVE WORK), OR USED FOR MANUFACTURE FOR ANYONE OTHER THAN SIKORSKY AIRCRAFT CORPORATION AND/OR ITS SUBSIDIARIES WITHOUT ITS WRITTEN CONSENT, AND THAT NO RIGHT IS GRANTED TO DISCLOSE OR SO USE ANY INFORMATION CONTAINED HEREIN. ALL RIGHTS RESERVED. ANY ACT IN VIOLATION OF APPLICABLE LAW MAY RESULT IN CIVIL AND CRIMINAL PENALTIES.

EXPORT WARNING: THESE COMMODITIES, TECHNICAL DATA OR SOFTWARE ARE SUBJECT TO THE EXPORT CONTROL OF EITHER THE INTERNATIONAL TRAFFIC IN ARMS REGULATIONS (ITAR) OR THE EXPORT ADMINISTRATION REGULATIONS (EAR) AND CANNOT BE EXPORTED WITHOUT THE PRIOR AUTHORIZATION OF EITHER THE DEPARTMENT OF STATE OR THE DEPARTMENT OF COMMERCE. THE TERM "EXPORT" INCLUDES ANY DISCLOSURE AND/OR PROVISION OF ACCESS TO COMMODITIES, TECHNICAL DATA OR SOFTWARE TO OR BY FOREIGN NATIONALS (WHETHER LOCATED IN THE UNITED STATES OR ABROAD). THIS REQUIREMENT ALSO APPLIES TO FOREIGN NATIONAL EMPLOYEES OF U.S. COMPANIES AND THEIR FOREIGN SUBSIDIARIES.

269D™ IS A REGISTERED TRADEMARK OF SIKORSKY AIRCRAFT CORPORATION.

ASB DB-045  
BASIC ISSUE ▪ July 25/13

**SUBJECT:** One-Time Engine Alignment Check and Inspection of the KAflex® Drive Shaft, KAflex Coupling Assembly, and Engine Mount Assembly Absorbers

#### Section 1. PLANNING INFORMATION

- A. Effectivity All 269D Configuration "M" and "MB" model helicopters.
- Component: KAflex Drive Shaft, Part Number (P/N) SKCP2738-5, KAflex Coupling Assembly, P/N SKCP2738-7, and Engine Mount Assembly Absorbers, P/N's 269A8605 and 269A8606.
- B. Purpose To perform a one-time engine alignment check and inspection of the KAflex Drive Shaft, and KAflex Coupling Assembly for fretting, cracks wear and movement, and Engine Mount Assembly Absorbers for compression.
- C. Description Helicopter is prepared for maintenance. Access is gained to KAflex Drive Shaft, KAflex Coupling Assembly, and Engine Mount Assembly Absorbers. A one-time engine alignment check and inspection of the KAflex Drive Shaft, and KAflex Coupling Assembly for fretting, cracks, wear, and movement, and Engine Mount Assembly Absorbers for compression, is performed. If KAflex Drive Shaft, KAflex Coupling Assembly, or Engine Mount Assembly Absorbers fail the inspection performed in this Alert Service Bulletin (ASB), or any discrepancies are found, remove drive shaft from service and return to Helicopter Support, Inc. (HSI). Record findings in the ASB Work Sheet (Section 3. E). If KAflex Drive Shaft, KAflex Coupling Assembly, and Engine Mount Assembly Absorbers pass this inspection, helicopter is returned to service.

KAflex® is a registered trademark of Kamatics Corporation

ONE-TIME  
ALIGNMENT  
CHECK

Section 1. PLANNING INFORMATION (Continued)

- D. Compliance Compliance is essential. Inspection must be accomplished within the next 25 flight hours or 60 days from the issue date of this ASB, whichever occurs first.
- E. Approval Inspection item.
- F. Manpower (Estimated)

<u>Task</u>	<u>No. of Men</u>	<u>No. of Hours</u>	<u>Man-Hours*</u>
Engine Alignment Check Method 1	1	1.20	1.2
Inspection of KAflex Drive Shaft and Coupling	1	0.70	0.7
Complete Compliance Record Card	1	0.16	<u>0.2</u>
<b>Total Man-Hours</b>			<b>2.1</b>

\*Estimate does not include time required to prepare helicopter or return it to flight status.

\*\*If removal of the belt drive is required, add an additional 8 to 10 man-hours.

- G. Material  
Magnifying Glass (10X) (Commercially Available or equivalent)
- H. Tooling

<u>Qty</u>	<u>Nomenclature</u>	<u>Part No.</u>	<u>Source</u>
1	Engine Alignment Tool	269T3303	(1)
1	Belt Drive Alignment Tool	269T3303-003	(1)

(1) Available from Red Barn Machine, Inc. Website: [www.redbarn.net](http://www.redbarn.net).

- I. Weight and Balance  
Not Affected.
- J. Electrical Load Data  
Not Affected.
- K. Software Load Data  
Not Applicable.
- L. References
  - (1) Operation and Maintenance Instructions Manual (OMI) MSP-D-15.
  - (2) Handbook of Maintenance Instructions (HMI) MSP-D-18.

Section 1. PLANNING INFORMATION (Continued)

M. Publications Affected

None.

N. Attachment

None.

Section 2. MATERIAL INFORMATION

A. Basis for Material Data

Per helicopter.

B. Bill of Material

None.

C. Consumable Material

None.

Section 3. ACCOMPLISHMENT INSTRUCTIONS

A. Prepare helicopter for inspection:

- (1) Turn off all helicopter electrical power.

B. Perform engine alignment check:

- (1) Perform engine alignment check, Method I, using the Belt Drive Alignment Tool, P/N 269T3303. Refer to Table 3 for the applicable publication and helicopter model.
- (2) Record findings in the ASB Work Sheet (Section E).

C. Perform one-time inspection of KAflex Drive Shaft, KAflex Coupling Assembly (with KAflex removed), and Engine Mount Assembly Absorbers:

- (1) Remove KAflex Drive Shaft, and Coupling Assembly. Refer to Table 1 for applicable publication and helicopter model.
- (2) Refer to Figure 1 for example of fractured KAflex Assembly.

Section 3. ACCOMPLISHMENT INSTRUCTIONS (Continued)



DO NOT DISTURB OR TIGHTEN THE FLEX FRAME BOLTED JOINTS.

 
- (3) Check for working fastener condition at joints by hand (12 places, both sides) – black residue under head or tail. Metal wear will appear as powder (fretting debris) and appear black or red in color. If powder is found, remove the drive shaft from service. Refer to Figure 2 for location of inspection. Record findings in the ASB Work Sheet (Section E).
  - (a) If drive shaft is removed from service, proceed to step (11).
  - (b) If rejected condition is not found, proceed to step (4).

- (4) Visually inspect for cracks emanating from under head and/or tail of fasteners (12 places, both sides). Refer to Figure 2 for location of inspection. Record findings in the ASB Work Sheet (Section E).
  - (a) If drive shaft is removed from service, proceed to step (11).
  - (b) If rejected condition is not found, proceed to step (5).

NOTE: Torque stripes may have been painted over with corrosion resistant primer after assembly. This is a normal condition.

- (5) Inspect flex frame and mount bolt torque stripes for evidence of movement. If any evidence of movement is found, or torque stripes are no longer visible, remove drive shaft from service. Refer to Figure 2. Record findings in the ASB Work Sheet (Section E).
  - (a) If drive shaft is removed from service, proceed to step (11).
  - (b) If rejected condition is not found, proceed to step (6).
  - (c) If torque stripes have faded, repaint using torque seal or equivalent (Table 3-2, Item 139, OMI MSP-D-15; Table 2-2, item 128, HMI MSP-D-18) in the same location and orientation as previously applied. Refer to Figure 2.
- (6) Using a 10X magnifying glass or equivalent, visually inspect flex frame bolted joints for evidence of wear. If evidence of wear is found, remove drive shaft from service. Refer to Figure 2. Record findings in the ASB Work Sheet (Section E).
  - (a) If drive shaft is removed from service, proceed to step (11).
  - (b) If rejected condition is not found, proceed to step (7).

- (7) Using a 10X magnifying glass or equivalent, visually inspect flex frame for evidence of cracks over the full circumference (360 degrees) around the bolt head and washer side and over the full circumference (360 degrees) around the nut and washer side. If any evidence of cracking is found, remove drive shaft from service. Refer to Figure 2. Record findings in the ASB Work Sheet (Section E).



Section 3. ACCOMPLISHMENT INSTRUCTIONS (Continued)

- (a) If drive shaft is removed from service, proceed to step (11).
- (b) If rejected condition is not found, proceed to step (8).
- (8) Using a 10X magnifying glass or equivalent, visually inspect four inside and outside corner radii and radii edges for evidence of cracks on each flex frame. Inspect the corner radii edges on both sides of the flex frame. If any evidence of cracking is found, remove drive shaft from service. Refer to Figure 2. Record findings in the ASB Work Sheet (Section E).
  - (a) If drive shaft is removed from service, proceed to step (11).
  - (b) If rejected condition is not found, proceed to step (9).
- (9) Using a 10X magnifying glass or equivalent, visually inspect each shaft end-fitting flange for evidence of cracks over the full circumference (360 degrees) around the nut and washer side. If any evidence of cracking is found, remove drive shaft from service. Refer to Figure 2. Record findings in the ASB Work Sheet (Section E).
  - (a) If drive shaft is removed from service, proceed to step (11).
  - (b) If rejected condition is not found, proceed to step (10).
- (10) Inspect absorbers, P/N 269A8605 and 269A8606, on engine mount assembly and replace with new absorbers if bottom inner absorber rotates freely by hand. Refer to Table 2 for applicable publication and helicopter model. Record findings in the ASB Work Sheet (Section E).
- (11) If a rejected condition is found, fill out attached Sikorsky Engineering Evaluation return form and ASB Work Sheet (Section E). Forward KAflex Assembly and completed forms to:

Helicopter Support, Inc. (HSI)  
URGENT: Engineering Evaluation  
Attn: SAS Commercial Aircraft Product Support  
300 Montowese Avenue Extension  
North Haven, CT 06373
- (12) If a rejected condition is not found, fill out attached ASB Work Sheet (Section E) and forward to address above. Reinstall KAflex Drive Shaft, and Coupling Assembly. Refer to Table 4 for the applicable publication and helicopter model.
- (13) Perform engine alignment check, Method I, using the Engine Alignment Tool, P/N 269T3303, and the Belt Drive Alignment Tool, P/N 269T3303-003. Refer to Table 1 for the applicable publication and helicopter model.

D. Return helicopter to service.

Section 3. ACCOMPLISHMENT INSTRUCTIONS (Continued)

E. ASB Work Sheet:

(1) Was KAflex out-of-line with transmission? \_\_\_\_\_ No \_\_\_\_\_ Yes

If realignment was required:

- Out-of-Alignment measurement (inches, degrees, etc.), if possible: \_\_\_\_\_
- How many shims were added: \_\_\_\_\_ removed: \_\_\_\_\_
- Provide thickness of shims added: \_\_\_\_\_ removed: \_\_\_\_\_

(2) Were there signs of fretting? \_\_\_\_\_ No \_\_\_\_\_ Yes

(3) Was there any movement of torque stripes? \_\_\_\_\_ No \_\_\_\_\_ Yes

(4) Was there any evidence of cracking? \_\_\_\_\_ No \_\_\_\_\_ Yes

Locations of Cracking:

- Flex frame bolted joints \_\_\_\_\_
- Flex frame \_\_\_\_\_
- Four inside and outside corner radii and radii edges \_\_\_\_\_
- Shaft end-fitting flange \_\_\_\_\_

 
(5) What was the condition of absorbers P/N 269A8605 and 269A8606?

- Compressed per applicable HMI Publication \_\_\_\_\_
- Uncompressed per applicable HMI Publication \_\_\_\_\_

(6) Was KAflex Drive Shaft rejected? \_\_\_\_\_ No \_\_\_\_\_ Yes

(7) If KAflex Drive Shaft was rejected, record the following:

- (a) Helicopter S/N: \_\_\_\_\_
- (b) Helicopter total time: \_\_\_\_\_
- (c) Rejected KAflex assembly S/N: \_\_\_\_\_
- (d) Rejected KAflex assembly cycles: \_\_\_\_\_



Section 3. ACCOMPLISHMENT INSTRUCTIONS (Continued)

**TABLE 1. KAflex DRIVE SHAFT AND COUPLING ASSEMBLY REMOVAL**

<b>Publication No. &amp; Reference</b>	<b>Model</b>
MSP-D-15, Chapter 7, Paragraph 7-26	269D Configuration M
MSP-D-18, Section 6, Paragraph 6-26	269D Configuration MB

**TABLE 2. ENGINE MOUNT ABSORBER INSPECTION**

<b>Publication No. &amp; Reference</b>	<b>Model</b>
MSP-D-15, Chapter 4, Paragraph 4-26, reference NOTE	269D Configuration M
MSP-D-18, Section 3, Paragraph 3-26, reference NOTE	269D Configuration MB

**TABLE 3. ENGINE ALIGNMENT CHECK**


<b>Publication No. &amp; Reference</b>	<b>Model</b>
MSP-D-15, Chapter 4, Paragraph 4-31	269D Configuration M
MSP-D-18, Section 3, Paragraph 3-31	269D Configuration MB

**TABLE 4. KAflex DRIVE SHAFT AND COUPLING ASSEMBLY INSTALLATION**

<b>Publication No. &amp; Reference</b>	<b>Model</b>
MSP-D-15, Chapter 7, Paragraph 7-28	269D Configuration M
MSP-D-18, Section 6, Paragraph 6-28	269D Configuration MB

F. Record of Compliance:

- (1) Make an appropriate helicopter logbook entry to show compliance with this ASB.
- (2) Upon compliance with the ASB, complete attached ALERT SERVICE BULLETIN COMPLIANCE RECORD CARD and ASB Work Sheet and return it to Sikorsky Aircraft Corporation.

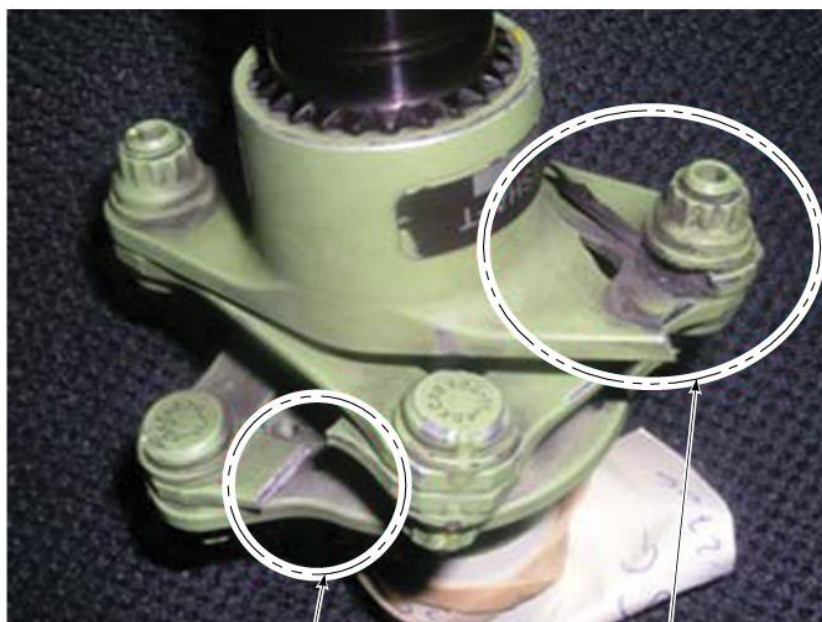


AREA OF INSPECTION FOR  
ENGINE COUPLING FLEX FRAME  
(SKCP2537-11)

AREA OF INSPECTION FOR  
ENGINE ADAPTER LUG  
(SKCP2985-11)

TD3119  
SA

Figure 1. Example of Fractured KAflex Assembly



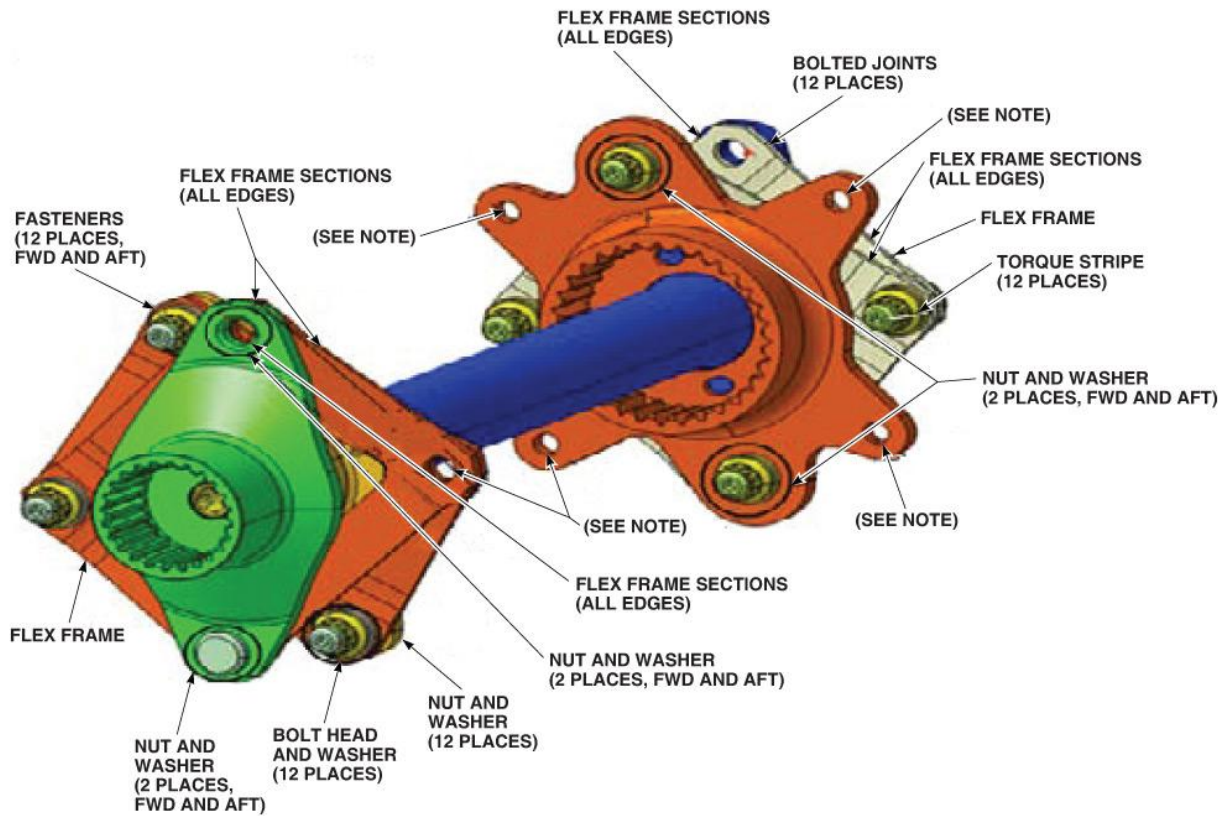

**NOTE**

HARDWARE NOT INSTALLED FOR GRAPHICAL PURPOSES. HARDWARE MUST BE INSTALLED IN ACCORDANCE WITH (IAW) THE APPLICABLE HMI.

TD3120  
 SA

Figure 2. Kflex Assembly Inspection Locations  
 (Image representative of P/N SKCP2738-5/-7, but not identical.)

ONE-TIME  
 ALIGNMENT  
 CHECK

(Fold over and tape closed)

**SIKORSKY AIRCRAFT CORPORATION**

**FACSIMILE NUMBER (860) 998-7565**

**EMAIL ADDRESS: [GPSIKSASProductSafet@utc.com](mailto:GPSIKSASProductSafet@utc.com)**

ATTENTION: SAS PRODUCT SAFETY MANAGER  
SIKORSKY AEROSPACE SERVICES



**IMPORTANT NOTICE**

Upon **COMPLIANCE** with the attached ASB, Sikorsky requests your cooperation in completing and returning this **ENTIRE PAGE** by **MAIL, FAX, or scan & EMAIL**.

*If you have internet access, you may go to [www.sikorsky.com](http://www.sikorsky.com) to record your compliance.*

Please fill in the requested information at the bottom of the page, so we may maintain proper records documenting the configuration of your aircraft. This information is useful when determining configuration and effectivity of issues affecting fielded aircraft.

This request is in keeping with our policy to assure that our customers receive the latest information applicable for the maintenance of your aircraft. Thank you.

**ALERT SERVICE BULLETIN:**            ASB No. DB-045            **Compliance Record Card**

**TITLE:** One-Time Engine Alignment Check and Inspection of the Kaflex® Drive Shaft,  
Kaflex® Coupling Assembly and Engine Mount Assembly Absorbers

**OWNER/OPERATOR:** \_\_\_\_\_

**SUBMITTED BY:** \_\_\_\_\_            **DATE:** \_\_\_\_\_

**FOLLOWING SERIAL NUMBERS ARE NOT AFFECTED BY THIS ASB**

**ASB HAS BEEN COMPLIED WITH ON HELICOPTER SERIAL NUMBERS:**

\_\_\_\_\_  
\_\_\_\_\_

(Fold Up to Arrows)



No Postage  
Necessary

---

**BUSINESS REPLY MAIL**  
**FIRST-CLASS MAIL PERMIT NO. 432 BRIDGEPORT CT**

---

**POSTAGE WILL BE PAID BY ADDRESSEE**

**SIKORSKY AIRCRAFT CORPORATION**  
P.O. BOX 9729  
6900 MAIN STREET  
STRATFORD, CONNECTICUT 06615-9129 U.S.A.  
MAILSTOP: **S328A**  
ATTENTION: SAS PRODUCT SAFETY MANAGER  
SIKORSKY AEROSPACE SERVICES

**Please complete the form on the reverse side and FAX to**  
**FACSIMILE NUMBER (860) 998-7565**  
**Or scan and email to:**  
**EMAIL ADDRESS: [GPSIKSASProductSafet@utc.com](mailto:GPSIKSASProductSafet@utc.com)**  
**or fold and return ENTIRE form to Sikorsky Aircraft Corporation**