

HUGHES SERVICE INFORMATION

NOTICE NO. N-28 DATE April 1, 1967 PAGE 1 OF ________

SUBJECT:

REMOVAL - AN960-416L WASHERS, ENGINE COOLING SHROUD SIDE PANEL ASSEMBLIES

MODELS AFFECTED:

All 269A Series Helicopters.

TIME OF COMPLIANCE:

At owners and operators discretion.

PURPOSE:

To increase security of attachment screws on engine

cooling shroud side panel assemblies.

Reference

269A/A-1 Handbook of Maintenance Instructions

- a. Remove six each AN515-416R8 screws, AN936B416 lockwashers, and AN960-416L (flat) washers from LH side and RH side engine cooling shroud panel assemblies. (Refer to Figure 1)
- b. Reinstall screws and lockwashers only.

CUSTOMER SERVICE DEPARTMENT . HUGHES TOOL COMPANY . AIRCRAFT DIVISION . CULVER CITY, CALIFORNIA

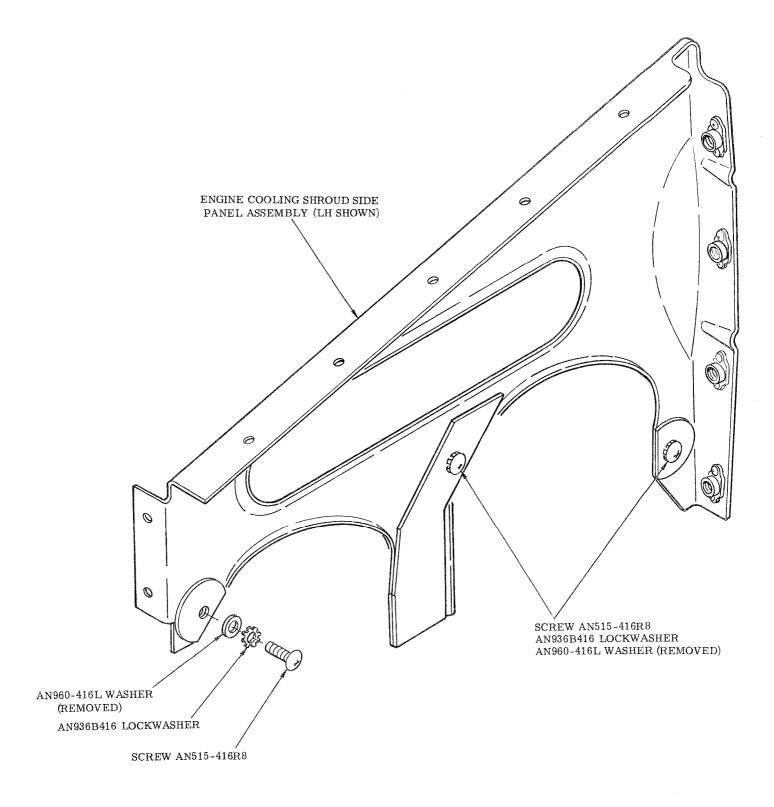


Figure 1. Engine Cooling Shroud Side Panel Assembly